

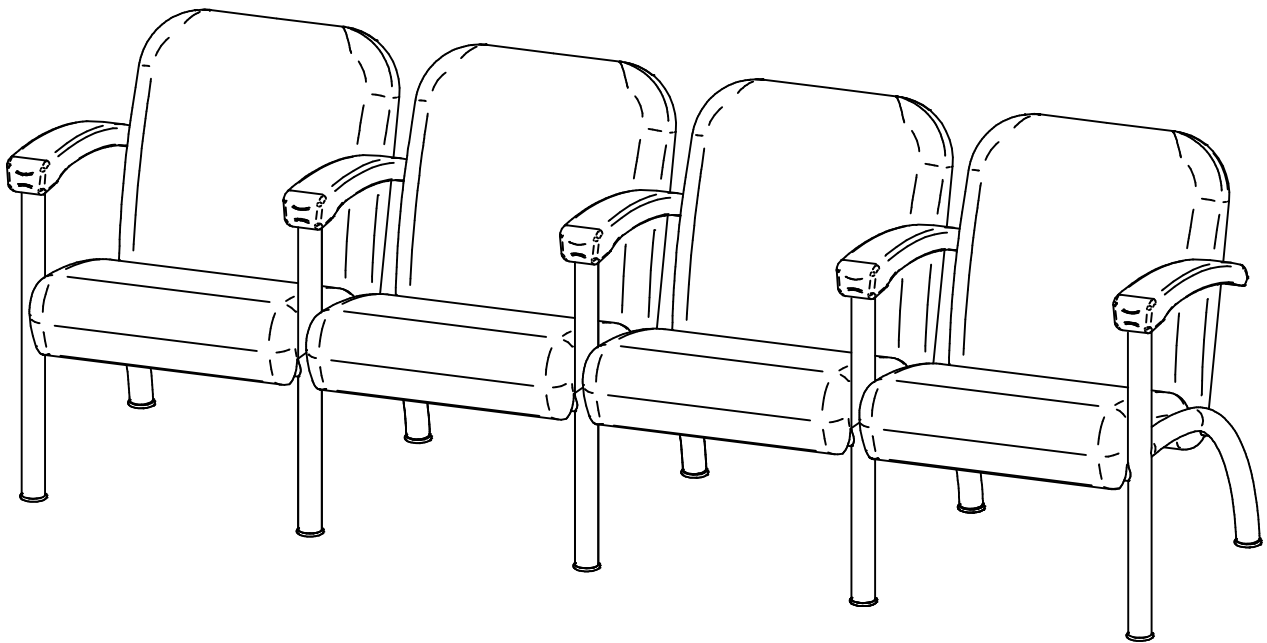




COMPANION



Configured Seating

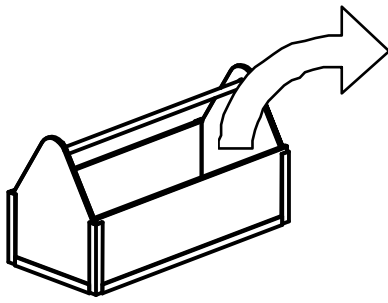

3/16



5/16

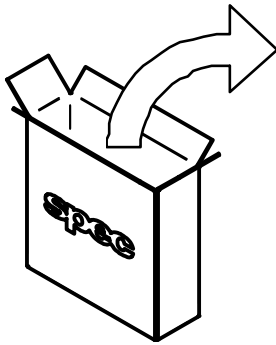

HDW-0001
1/4-20 x 1" Bolt

x4



HDW-0031
1/4 Lock Washer

x4




HDW-0068
1/4-20 Nylon Lock Nut



x4

*Per connection.

1

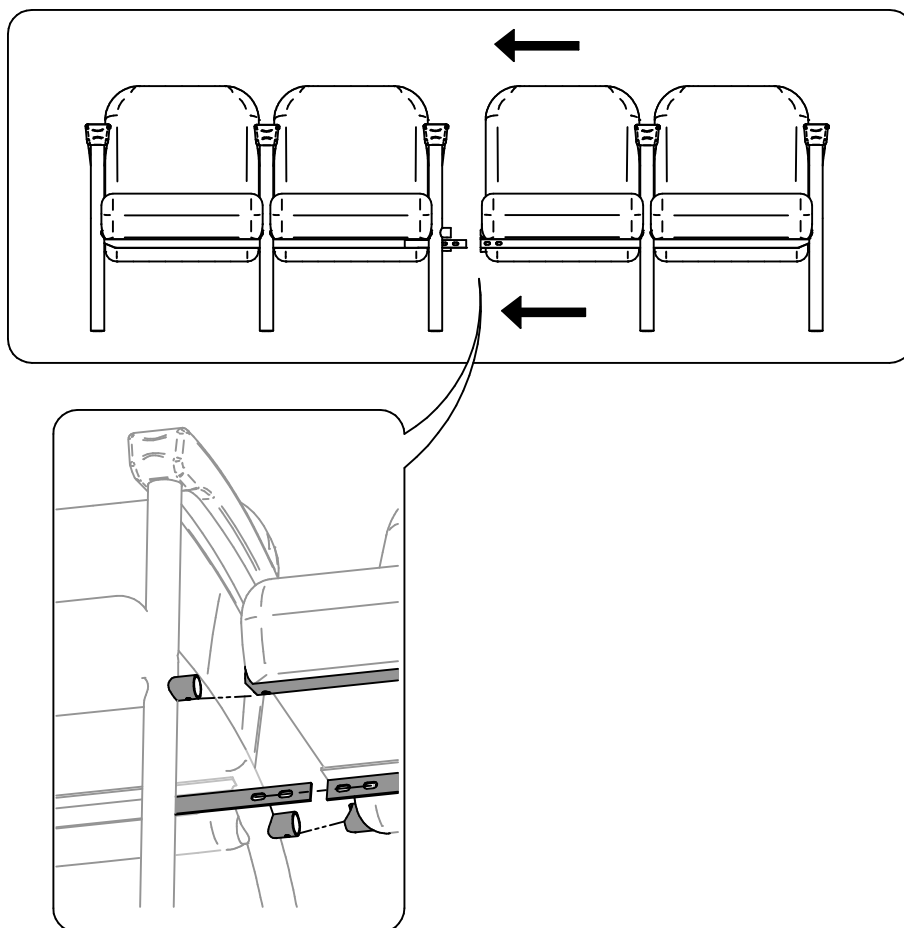

2

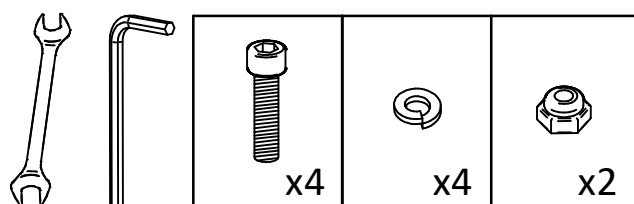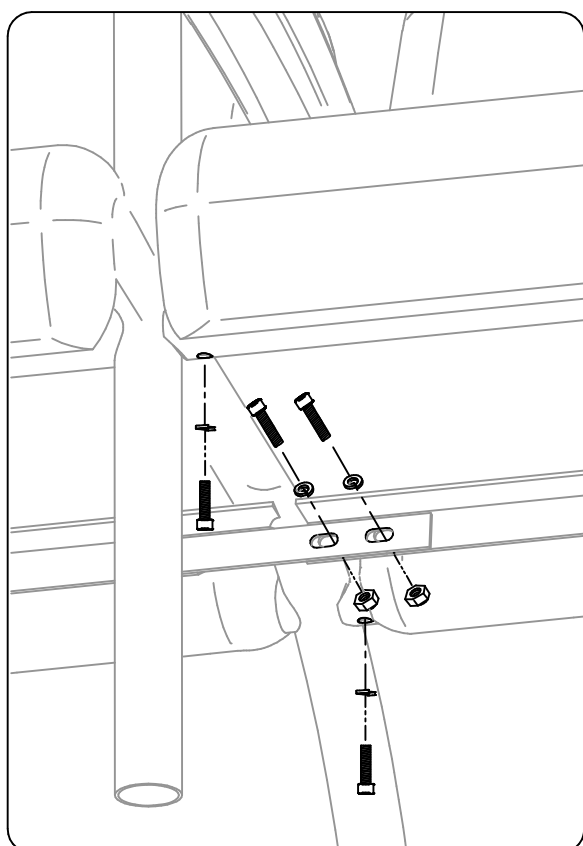


Spec Furniture Inc.

165 City View Drive, Toronto ON, M9W 5B1





P: 416.246.5540 | **F:** 416.246.5547

E: specit@specfurniture.com | specfurniture.com

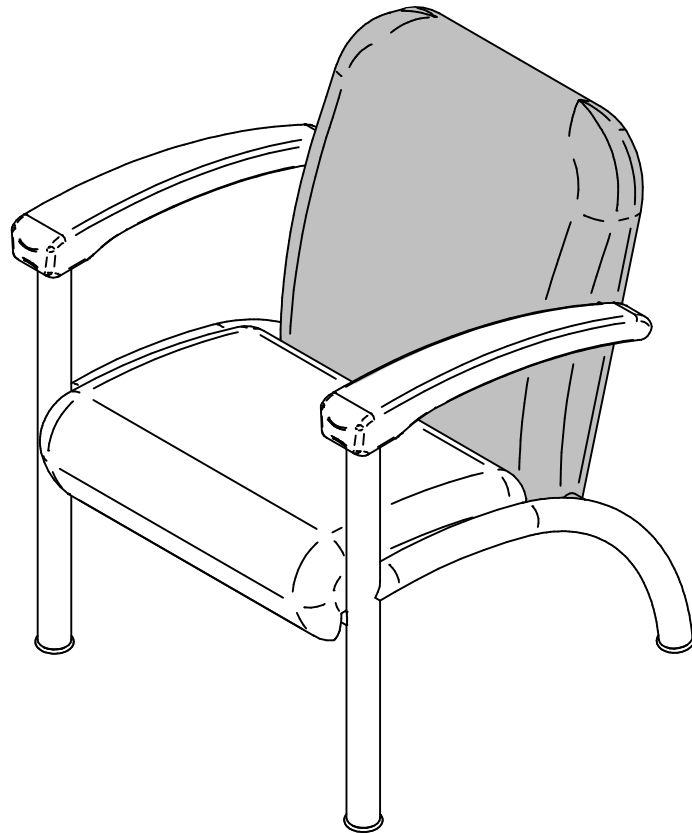


COMPANION

Back Replacement

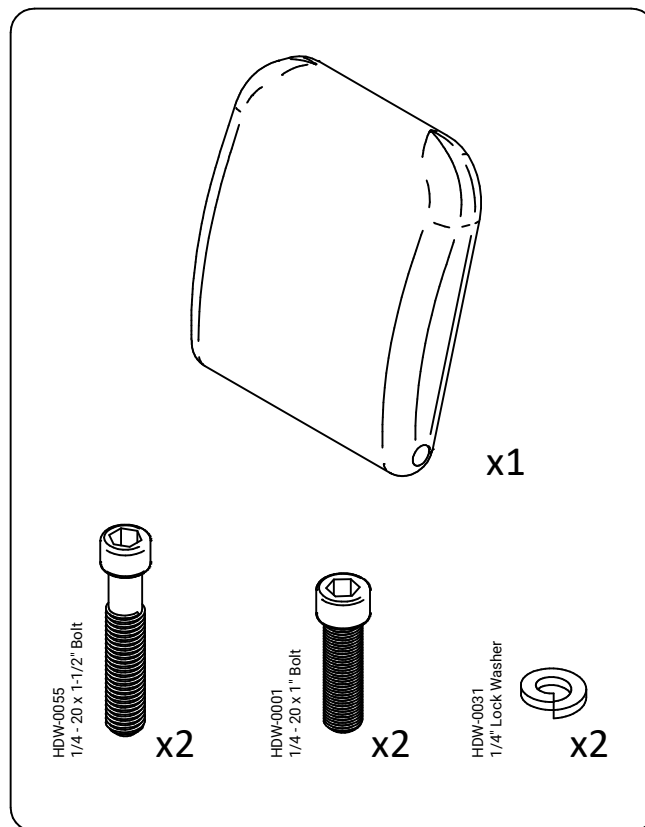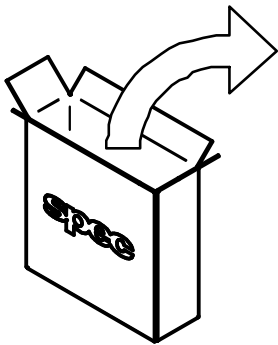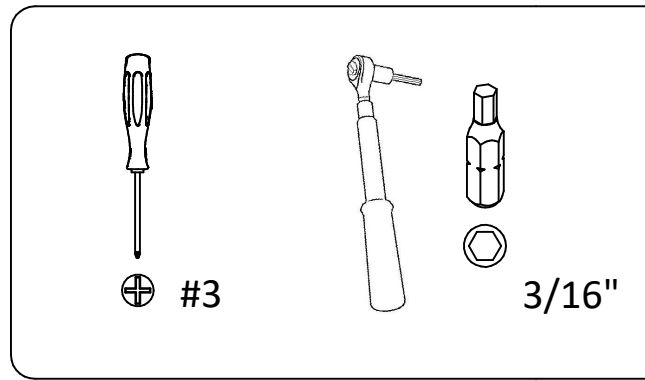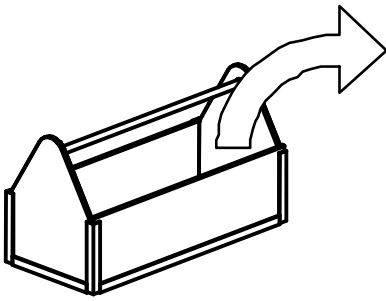


Note: Do not over-tighten fasteners.


1

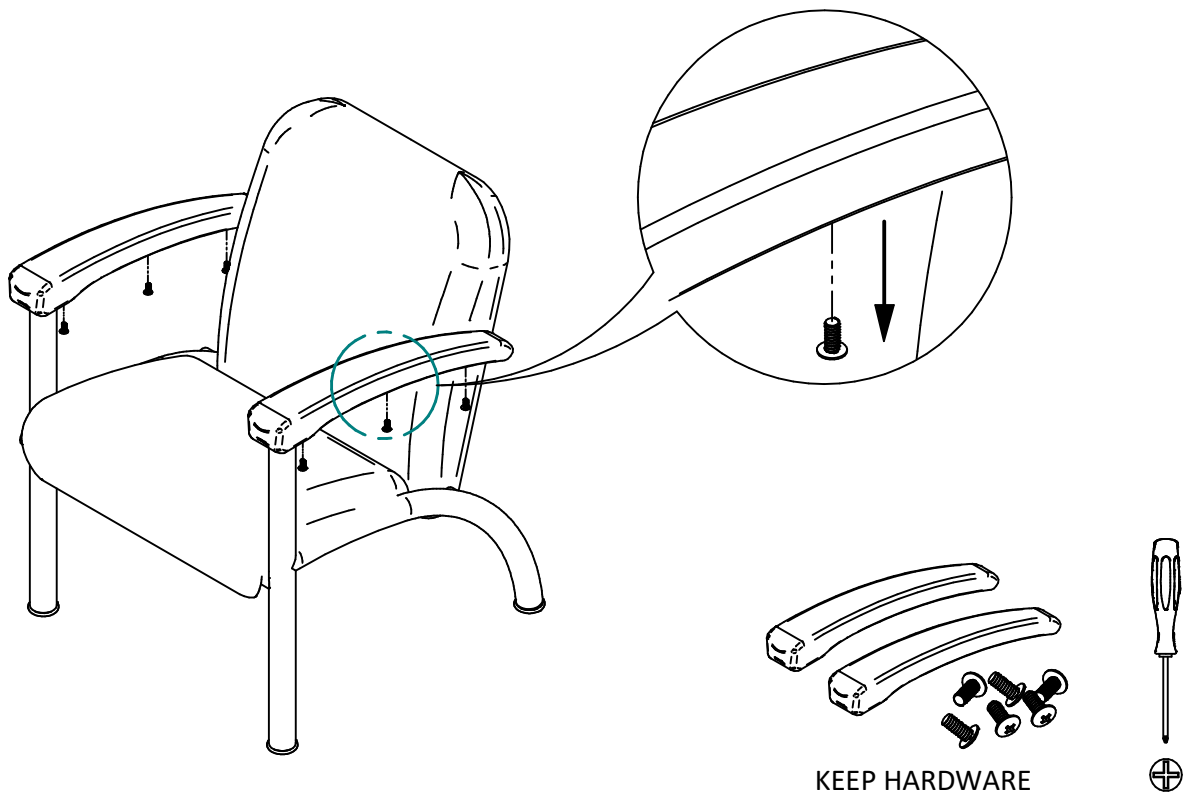


2

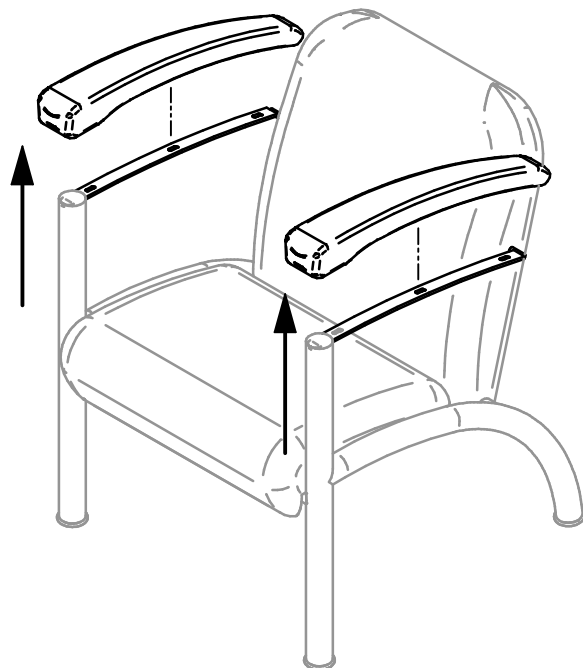


3

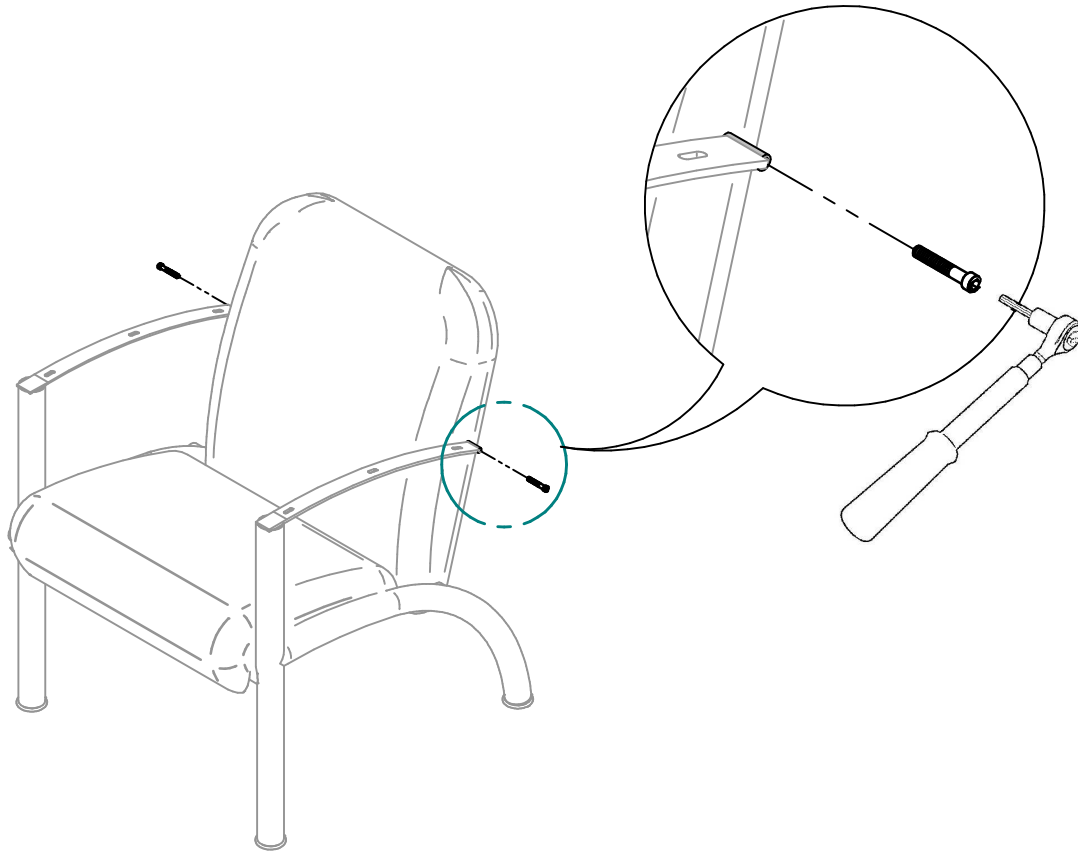

4

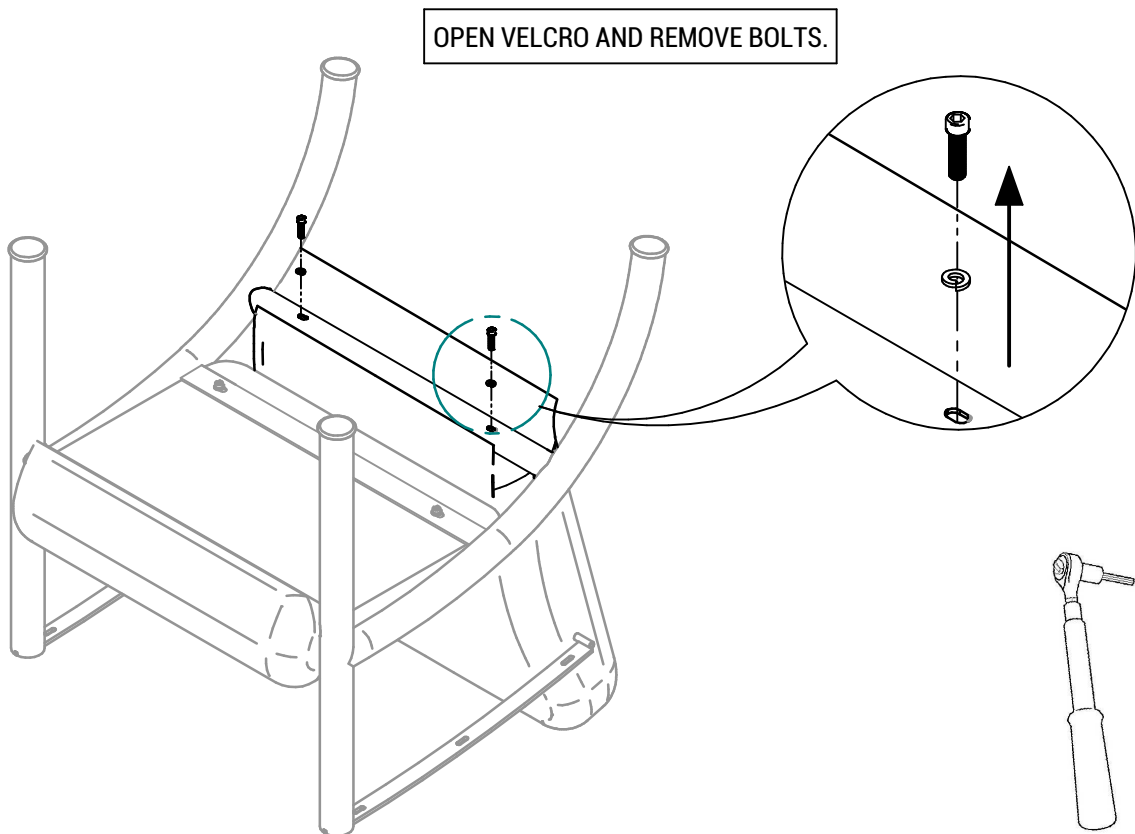


5

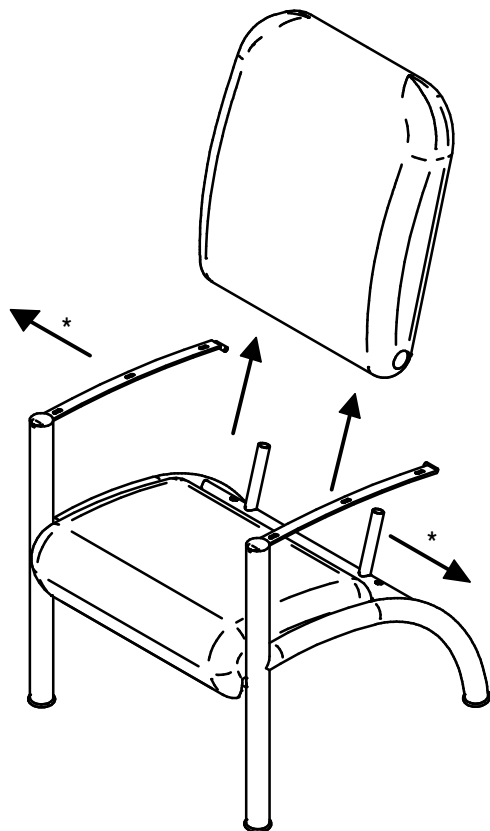


***NOTE:** THE ARM STRAPS MAY NEED TO BE PUSHED OUTWARD TO GET BACK OUT.

6


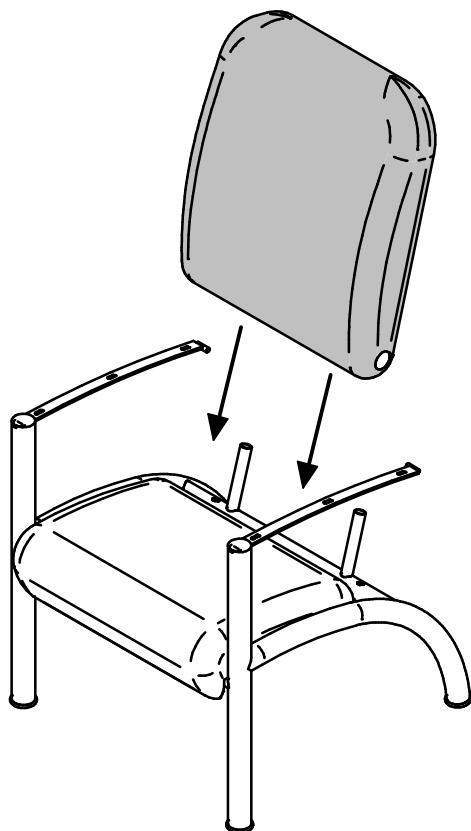


OPEN VELCRO ON NEW BACK
AND POSTION IN PLACE.



7

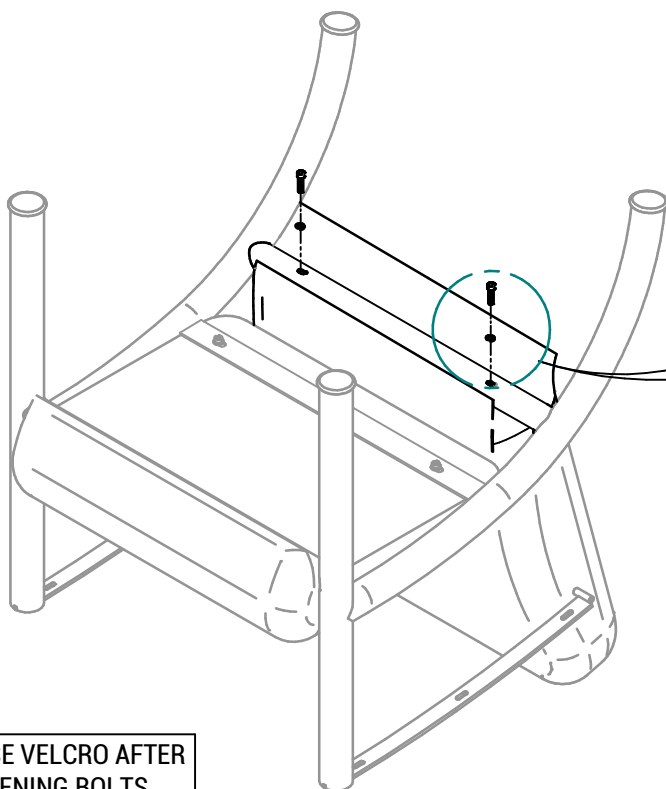


CLOSE VELCRO AFTER FASTENING BOLTS.

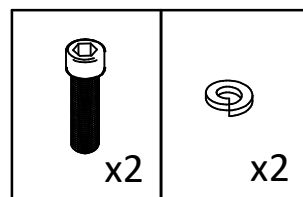


8

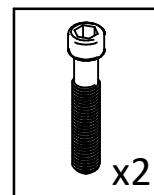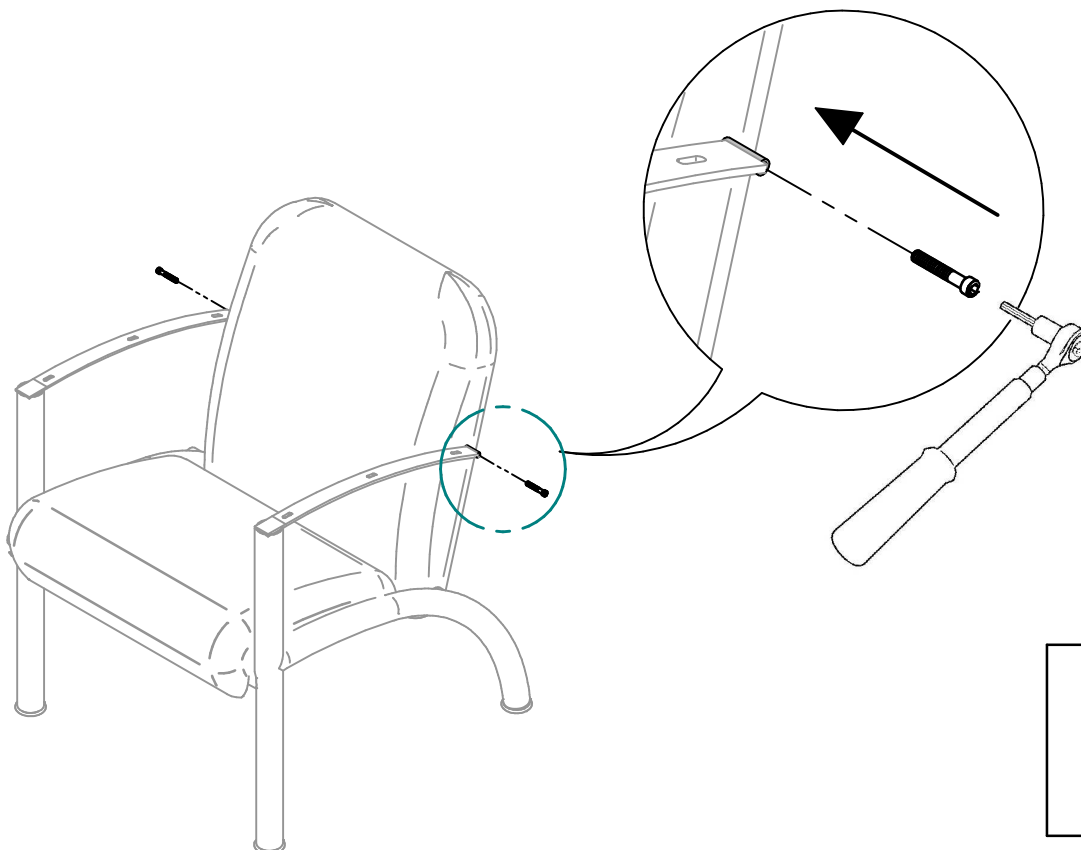

9

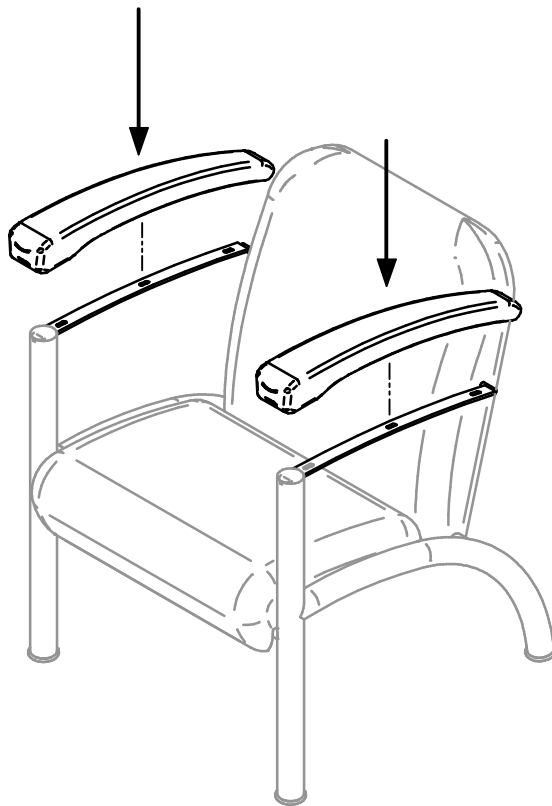

10

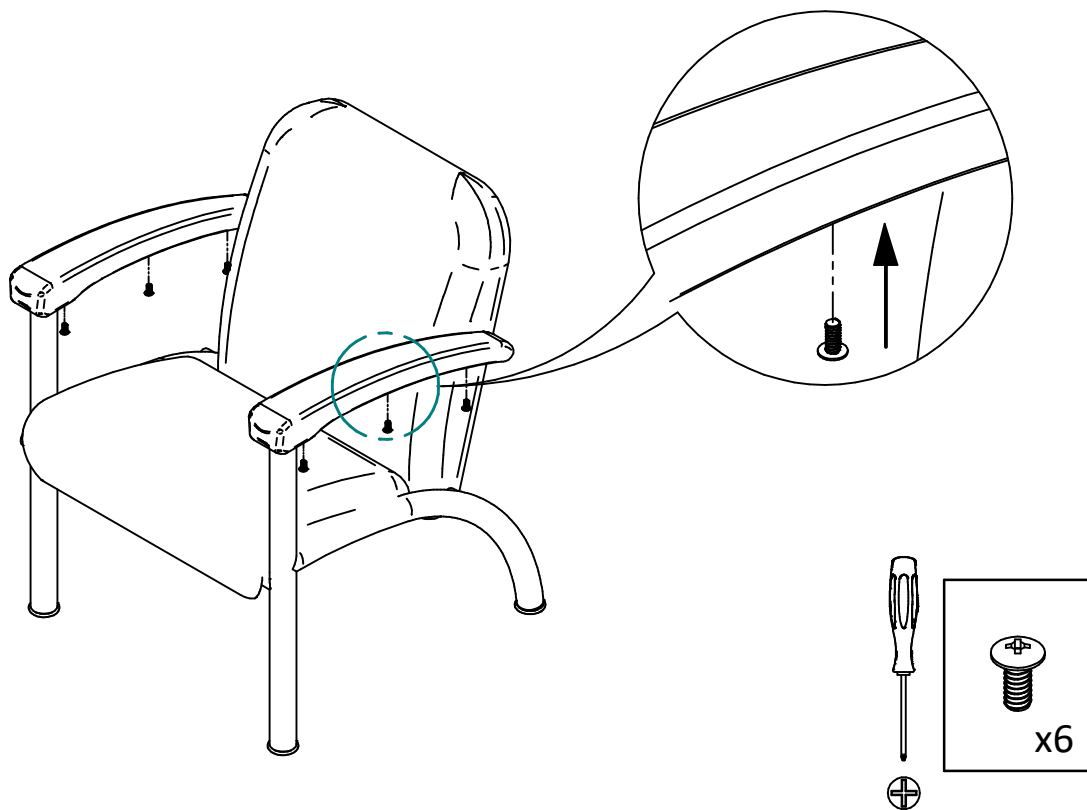


Spec Furniture Inc.

165 City View Drive, Toronto ON, M9W 5B1





P: 416.246.5540 | **F:** 416.246.5547

E: specit@specfurniture.com | specfurniture.com

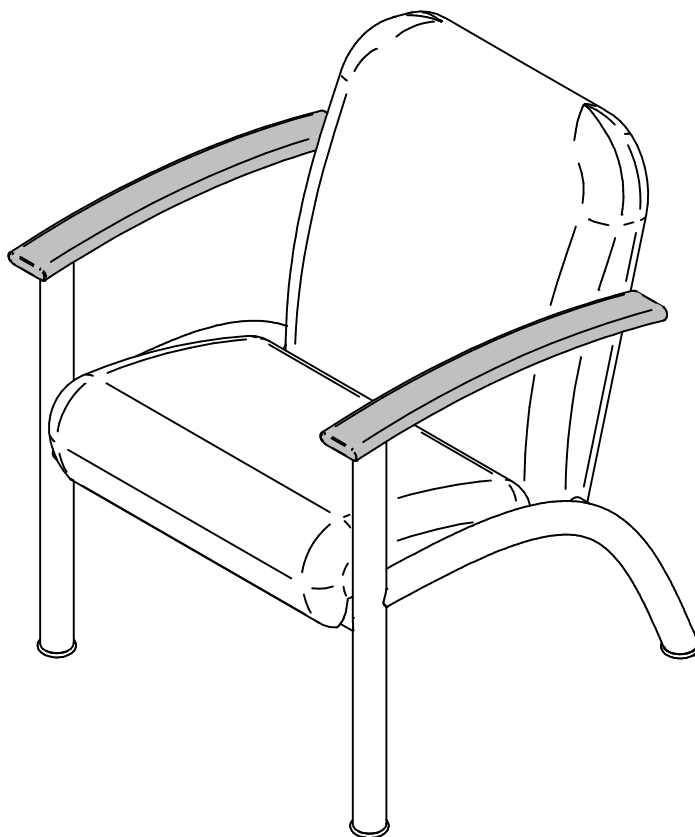


COMPANION

Replacement Steel Arm

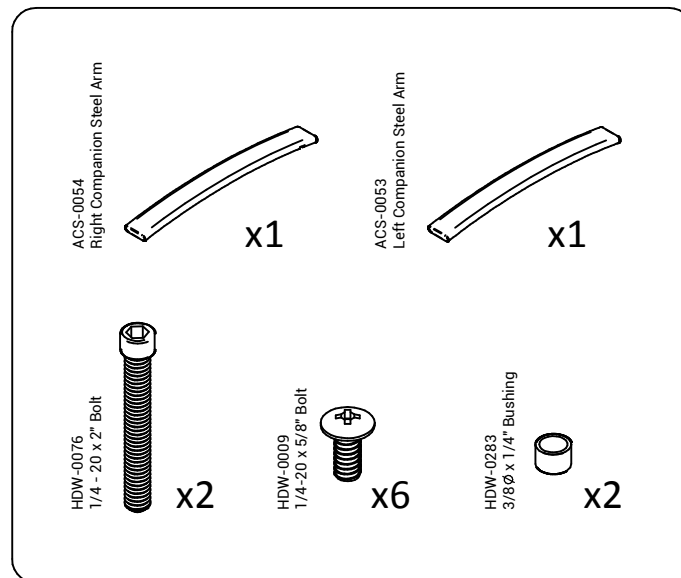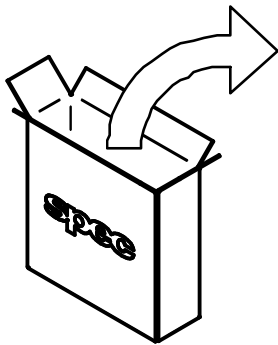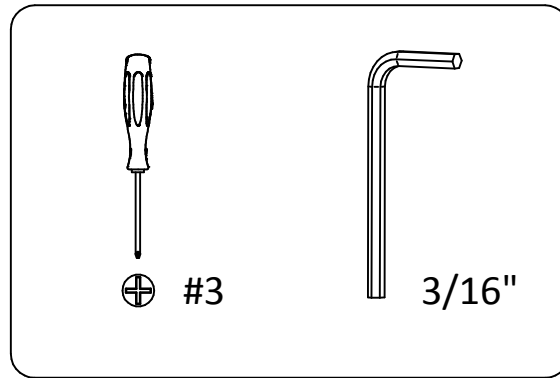
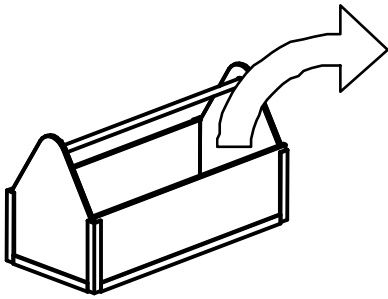


Note: Do not over-tighten fasteners.



1

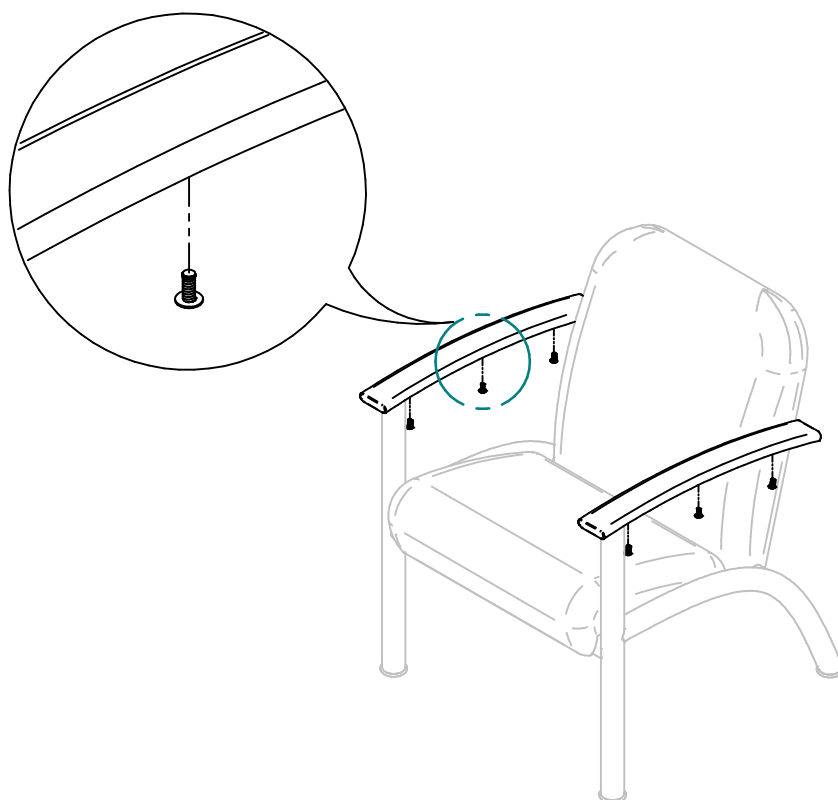



2

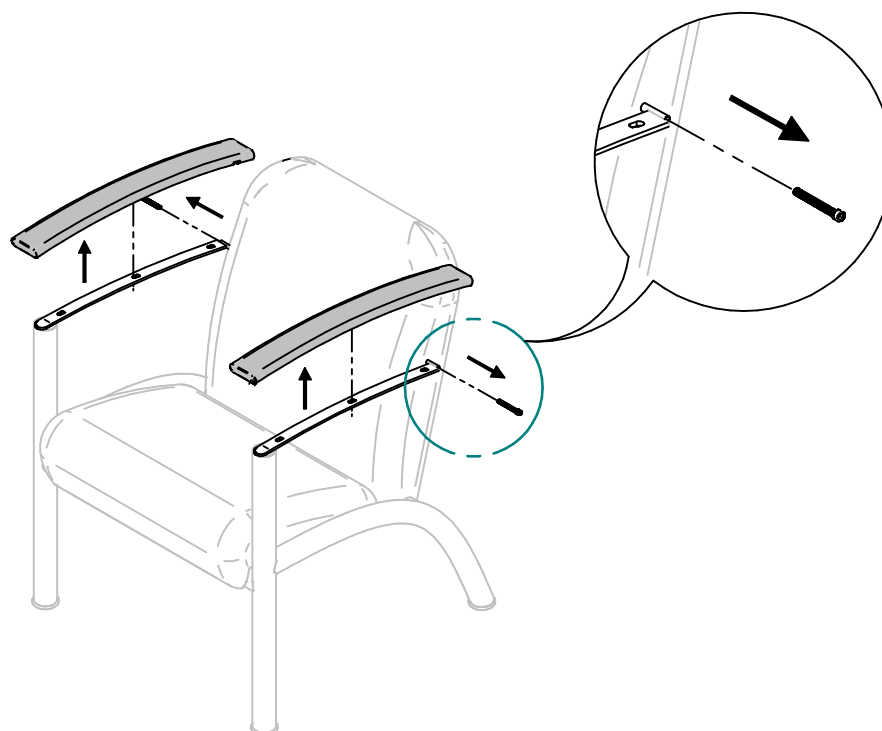


3

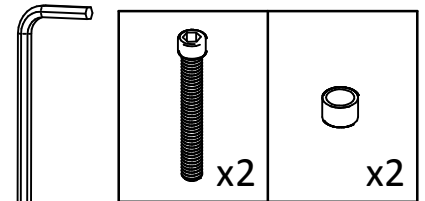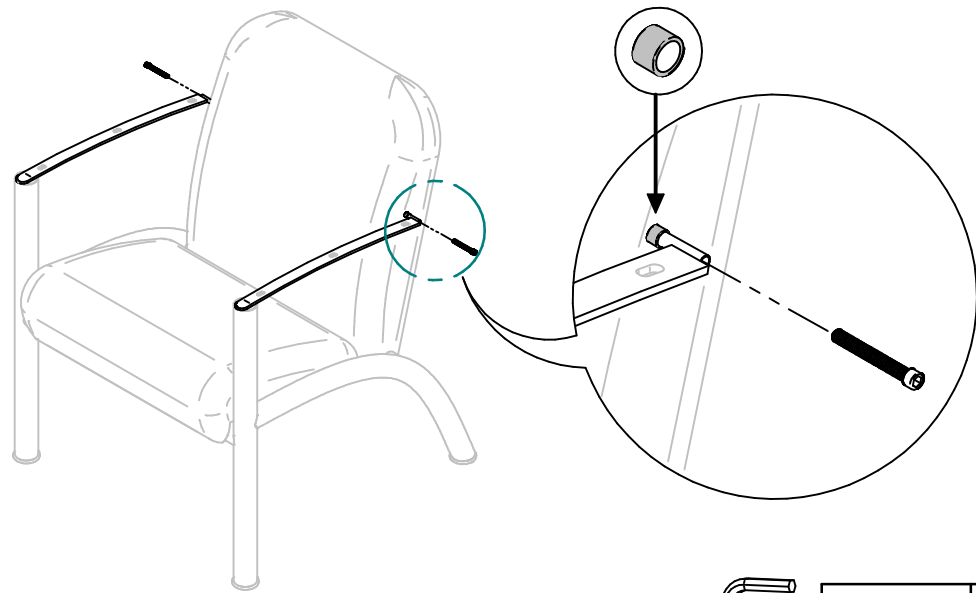





4

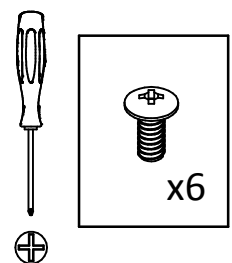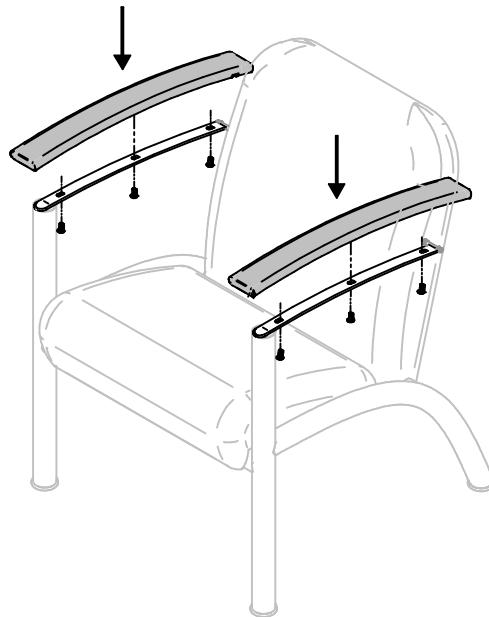

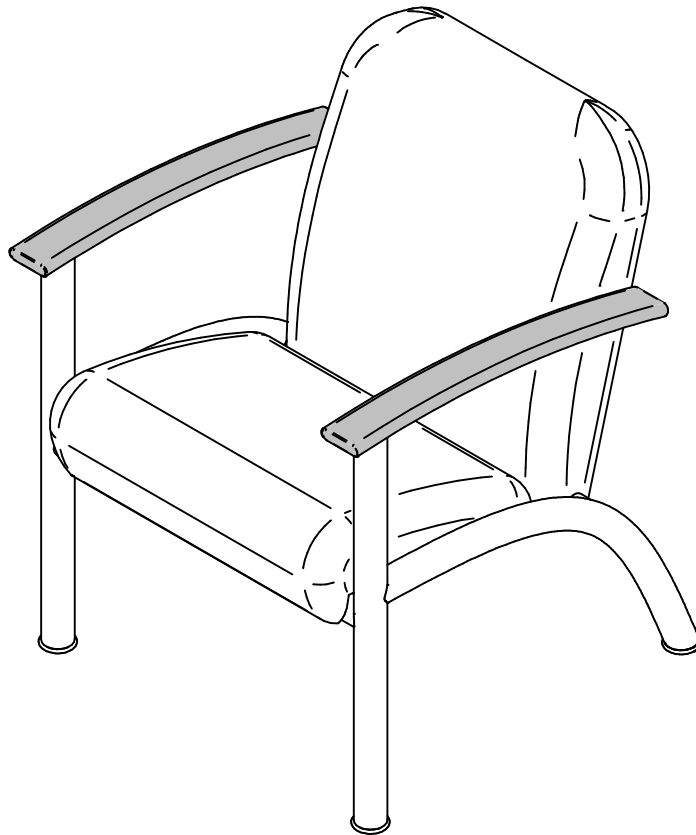


COMPANION

Replacement Steel Arm

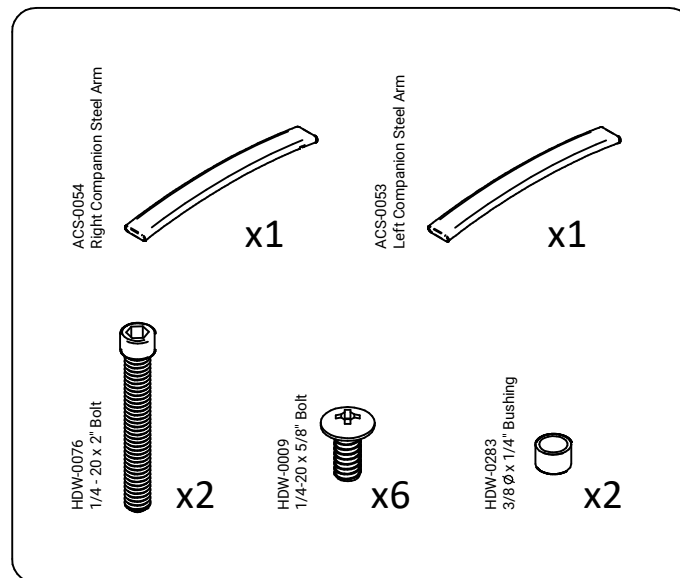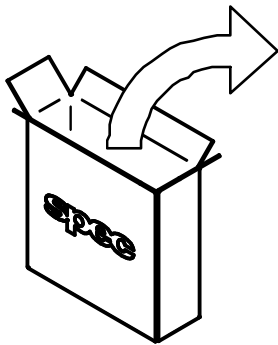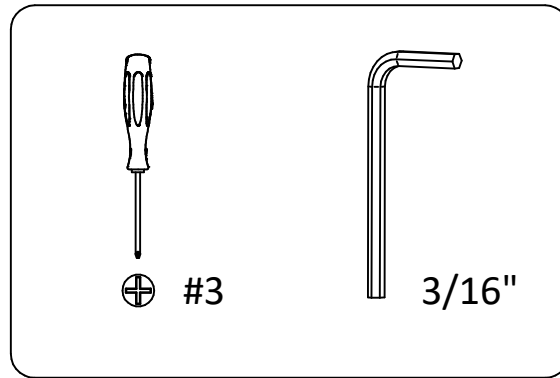
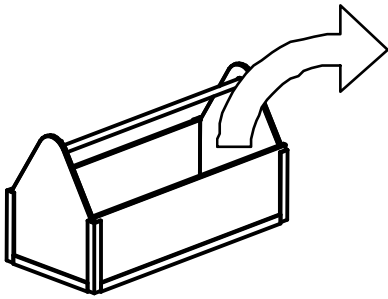


Note: Do not over-tighten fasteners.



1

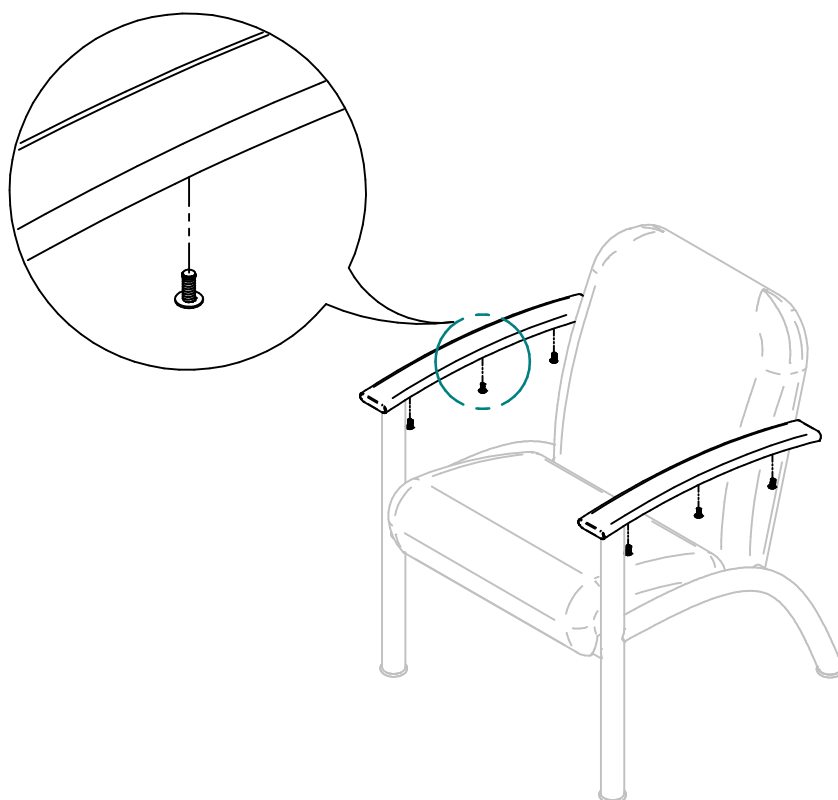



2

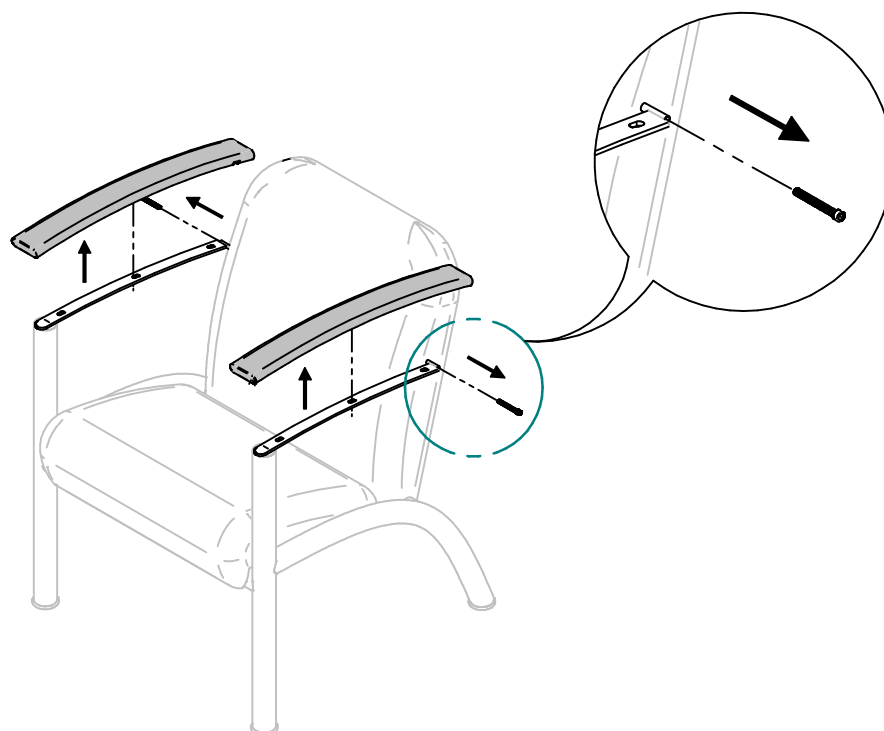

3

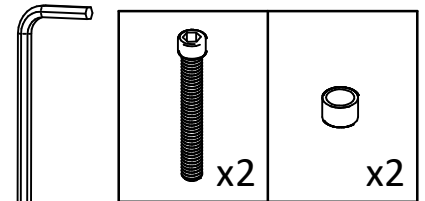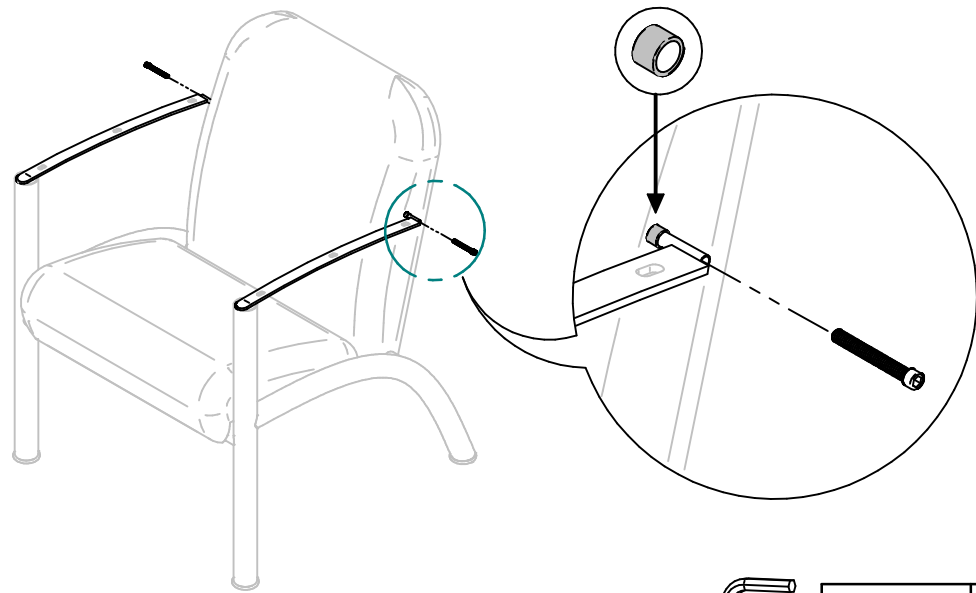

4

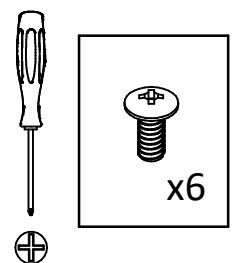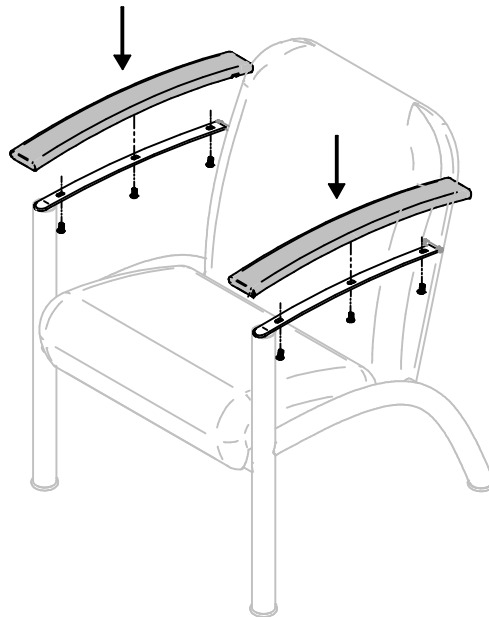

Spec Furniture Inc.
 165 City View Drive, Toronto ON, M9W 5B1
P: 416.246.5540 | **F:** 416.246.5547
E: specit@specfurniture.com | specfurniture.com